

Work Order ID 85314

85314

Page 1

June-05-12 3:36:17 PM

Item ID: D407-667-105

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 12/06/05 Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D407-667-145

Rev C (DEO)

DSI9565

A

100

0.00

51

100

DC

Document Control

DOCUMENT CONTROL

Memo

Photocopy bluefile and create labels as per PPP D407-667-105 CHG001

0.00

005

relosky

MLJ 12-8-14

110

0.00

110

Packaging

Packaging

Packaging

Memo

0.00

MO 12/7/31

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Offset/Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unauthorized <input type="checkbox"/>											

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material	<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____

Work Order ID 85314

85314

Page 2

June-05-12 3:36:17 PM

Item ID: D407-667-105

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
---------	--------	-----------	------------	------------	---------------	-------------

120

0.00

120

BENDING MACHINE - CROSSTUBES

CNC Bend 2

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D407-667-145 using CNC bender program 407-fw

mo/TW

12/8/2

130

QC15- Crosstube Dimensional Check

0.00

130

QC

Memo

0.00

Quality Control

DAS 16 12/08/03

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Offset/Setup											
Other											
Process											
Supplier											
Training											
Unauthorized											

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material	<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____

Work Order ID 85314***85314***

Page 3

June-05-12 3:36:17 PM

Item ID: D407-667-105

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

0.00

140

Crosstubes

Crosstubes

Memo

0.00

Crosstubes

1- scribe batch # inside of cuff

2-Drill pilot holes in tube using drill Jig DT8541 & DT8542 as per Dwg D407-667-145. Drill all (3) top holes use drill table jig DT8577 hole #1,#11 to set up towers, as per QSI0010.

3-Drill and Ream all holes in tube to finish size using drill Jig DT8541 & DT8542 as per Dwg D407-667-145 Check dimensions between holes on all four sides.

4-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

5-Drill pilot holes using drill Jig DT8541 & DT8542 as per Dwg 407-667-145. Drill only the top (2) holes.

6-Drill & ream the top (2) holes to finish size using drill Jig DT8541 & DT8542 as per Dwg D407-667-145

7-Drill Fwd rivet holes using drill Jig DT8787FWD as per Dwg D206-667-145. Note: Fwd side has 3x top holes.

8-Drill Aft rivet holes using drill Jig DT8787AFT as per Dwg D407-667-145.

9-C'sink holes as per Dwg D407-667-145. Allow rivet to sit below surface to compensate for paint.

10 -Deburr & Inspect for surface damage. Repair damage within limits as per

JW

12-08-02

JW

12-08-03

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Offset/Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unauthorized <input type="checkbox"/>											

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material	<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____

Work Order ID 85314

June-05-12 3:36:17 PM

85314

Page 4

Item ID: D407-667-105

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Dwg D407-667-145

150
150

HandFXtube

Hand Finishing Crosstubes

Crosstubes Chemical Conversion

0.00

Memo

0.00

160
160

QC

Quality Control

QC7-Inspect Chemical Conversion Coat

0.00

Memo

0.00

170
170

QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

Memo

0.00



766063

** Wear gloves **

** Wear gloves **

1- Clean crosstube with wash n wipe

12-8-3

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Offset/Setup											
Other											
Process											
Supplier											
Training											
Unauthorized											

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material	<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____

Work Order ID 85314

June-05-12 3:36:17 PM

85314

Page 5

Item ID: D407-667-105

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

180

Outsource process - NDT per QSI038 4.1

0.00

180

Outsource2

Outsource process - NDT

AA

Wear gloves

0.00

Memo

OUTSIDE SERVICE -CROSSTUBES
Liquid Penetrant Inspection as per QSI 038 Or
Issue P/O ~~85314~~ LPI as per ASTM 1417
Level 2 Attach copy of NDT results to work order

P 17609

12-08-3

190

Packaging

0.00

190

Packaging

Packaging

AA

Wear gloves

0.00

Memo

Inspect for transit damage
Ensure copy of NDT results attached to work order.

12/8/36

200

QC5- Inspect part completeness to step on W/O

0.00

200

QC

Quality Control

AA

Wear gloves

Memo

Inspect for damage & ensure results are as per Dwg D206-667-145

0.00

1

12 08 04

204

Wear gloves

*1- Pressure wash and use wash'n wipe to clean tube
before Chemical Conversion*

12-8-3

205

QC 2

Wear gloves

12 08 04

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Prod. Eng. Coord. <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td><input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td><input type="checkbox"/></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>	<input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	<input type="checkbox"/>
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>	<input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	<input type="checkbox"/>															

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Offset/Setup									
Other									
Process									
Supplier									
Training									
Unauthorized									

FAULT CATEGORY

Landing Gear	Hardware	General	Maintenance
<input type="checkbox"/> Bending Passes Below Min	<input type="checkbox"/> Breaking	<input type="checkbox"/> Burrs	<input type="checkbox"/> Set-up
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> Missing	<input type="checkbox"/> Contamination	<input type="checkbox"/> Supplier
<input type="checkbox"/> Cracks	<input type="checkbox"/> Size/Length	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Temperature/Cure
<input type="checkbox"/> Crushed/Crimp at Bending	<input type="checkbox"/> Spinning	<input type="checkbox"/> Documentation/Data	<input type="checkbox"/> Weld
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Threading	<input type="checkbox"/> Finish	<input type="checkbox"/> Wrong Stock Pulled
<input type="checkbox"/> Other	<input type="checkbox"/> Wrong	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Other
<input type="checkbox"/> Positioned Wrong	Drill Holes	<input type="checkbox"/> Inspection Unqualified	
<input type="checkbox"/> Ripples on Inner Bend	<input type="checkbox"/> Misaligned	<input type="checkbox"/> Instructions Incomplete/Unclear	
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Ovalized	<input type="checkbox"/> Jigs/Fixtures/Tooling	
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Over/Undersized	<input type="checkbox"/> Kit Incorrect	
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Too Many	<input type="checkbox"/> Kit Missing	
			<input type="checkbox"/> Raw Material

Work Order ID 85314

June-05-12 3:36:17 PM

85314

Page 6

Item ID: D407-667-105

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

210

210

SprayPaint

Spray Painting

SprayPaint

*

Memo

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

PRIME:

Start Time: 7:00

Finish Time: 8:00

PAINT:

Start Time: 1:00

Finish Time: 2:00

220

220

QC

Quality Control

QC14- Inspect Spray Paint

0.00

Memo

0.00

Then, Wrap in plastic bag to protect from scratches

DAS
15
0-23 17/08/04

Wear gloves
DSI 95440
mask for cleanup

120804

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Offset/Setup											
Other											
Process											
Supplier											
Training											
Unauthorized											

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material	<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Work Order ID 85314

June-05-12 3:36:17 PM

85314

Page 7

Item ID: D407-667-105

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID Tool # Plan
Code

Accept Reject Reject Insp.
Qty Qty Number Stamp

230

0.00

230

Crosstubes

0.00

Crosstubes

Crosstubes

Memo

1-Abrade mating surfaces of support and crosstube with 400 grit sandpaper, clean the area with 4105S wash 'n' wipe

2-Install supports with Proseal 890 per DSI9565 and QSI 015
A/R Proseal 890 Batch: 122441

3- Torque bolts as per dwg

4-Install nut plates as per Dwg D407-667-145. Touch-up rivet heads with Imron paint.

AS

12-8-9

240

QC5- Inspect part completeness to step on W/O

0.00

240

QC

Memo

0.00

Quality Control

DAS
16
2-22

12/06/13

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Offset/Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unauthorized <input type="checkbox"/>											

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material	<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____

Work Order ID 85314

June-05-12 3:36:17 PM

85314

Page 8

Item ID: D407-667-105

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250	Pick Kit	0.00							
250									
Packaging	Memo	0.00							12/8/14 SP
Packaging									SP
260	QC4- 100% Inspect kits for completeness	0.00							
260									
QC	Memo	0.00							
Quality Control									
270	Packaging	0.00							
270									
Packaging	Memo	0.00							12/8/14 SP
Packaging	Identify and pack for shipping as per PPP D407-667-105								
	Location: <u>33</u>								
	PPP Rev: _____								

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Prod. Eng. Coord. <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td><input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td><input type="checkbox"/></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>	<input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	<input type="checkbox"/>
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>	<input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	<input type="checkbox"/>															

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Offset/Setup									
Other									
Process									
Supplier									
Training									
Unauthorized									

FAULT CATEGORY

Landing Gear	Hardware	General	Maintenance
<input type="checkbox"/> Bending Passes Below Min	<input type="checkbox"/> Breaking	<input type="checkbox"/> Burrs	<input type="checkbox"/> Set-up
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> Missing	<input type="checkbox"/> Contamination	<input type="checkbox"/> Supplier
<input type="checkbox"/> Cracks	<input type="checkbox"/> Size/Length	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Temperature/Cure
<input type="checkbox"/> Crushed/Crimp at Bending	<input type="checkbox"/> Spinning	<input type="checkbox"/> Documentation/Data	<input type="checkbox"/> Weld
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Threading	<input type="checkbox"/> Finish	<input type="checkbox"/> Wrong Stock Pulled
<input type="checkbox"/> Other	<input type="checkbox"/> Wrong	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Other
<input type="checkbox"/> Positioned Wrong		<input type="checkbox"/> Inspection Unqualified	
<input type="checkbox"/> Ripples on Inner Bend	Drill Holes	<input type="checkbox"/> Instructions Incomplete/Unclear	
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Misaligned	<input type="checkbox"/> Jigs/Fixtures/Tooling	
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Ovalized	<input type="checkbox"/> Kit Incorrect	
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Over/Undersized	<input type="checkbox"/> Kit Missing	
	<input type="checkbox"/> Too Many		

Work Order ID 85314

June-05-12 3:36:17 PM

85314

Page 9

Item ID: D407-667-105

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Crosstube Fwd

Stop

NS2

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursTool ID Tool # Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

280

QC21- Final Inspection - Work Order Release

0.00

280

QC

Memo

0.00

Quality Control

12/8/15

MLJ 12/08/14

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Offset/Setup											
Other											
Process											
Supplier											
Training											
Unauthorized											
FAULT CATEGORY											
Landing Gear			Hardware			General					
<input type="checkbox"/>	Bending Passes Below Min	<input type="checkbox"/>	Breaking	<input type="checkbox"/>	Burrs	<input type="checkbox"/>	Maintenance	<input type="checkbox"/>	Set-up		
<input type="checkbox"/>	Centre Not Concentric to O/S	<input type="checkbox"/>	Missing	<input type="checkbox"/>	Contamination	<input type="checkbox"/>	Mislabeled	<input type="checkbox"/>	Supplier		
<input type="checkbox"/>	Cracks	<input type="checkbox"/>	Size/Length	<input type="checkbox"/>	Cut Too Short	<input type="checkbox"/>	Off-Set	<input type="checkbox"/>	Temperature/Cure		
<input type="checkbox"/>	Crushed/Crimp at Bending	<input type="checkbox"/>	Spinning	<input type="checkbox"/>	Documentation/Data	<input type="checkbox"/>	Orientation Misread	<input type="checkbox"/>	Weld		
<input type="checkbox"/>	Inspection Strip in Tube	<input type="checkbox"/>	Threading	<input type="checkbox"/>	Finish	<input type="checkbox"/>	Out of Calibration	<input type="checkbox"/>	Wrong Stock Pulled		
<input type="checkbox"/>	Other	<input type="checkbox"/>	Wrong	<input type="checkbox"/>	Inspection Incomplete	<input type="checkbox"/>	Out of Sequence	<input type="checkbox"/>	Other		
<input type="checkbox"/>	Positioned Wrong	Drill Holes			<input type="checkbox"/>	Inspection Unqualified	<input type="checkbox"/>	Outside Dimensions			
<input type="checkbox"/>	Ripples on Inner Bend	<input type="checkbox"/>	Misaligned	<input type="checkbox"/>	Instructions Incomplete/Unclear	<input type="checkbox"/>	Over/Under tolerance				
<input type="checkbox"/>	Torque Waves in Extrusion	<input type="checkbox"/>	Ovalized	<input type="checkbox"/>	Jigs/Fixtures/Tooling	<input type="checkbox"/>	Part Lost				
<input type="checkbox"/>	Turning Sequence	<input type="checkbox"/>	Over/Undersized	<input type="checkbox"/>	Kit Incorrect	<input type="checkbox"/>	Part Moved				
<input type="checkbox"/>	Wave/Twist in Tube	<input type="checkbox"/>	Too Many	<input type="checkbox"/>	Kit Missing	<input type="checkbox"/>	Raw Material				

Picklist Print

June-05-12 3:36:21 PM

Page 1

Work Order ID: 85314

Parent Item: D407-667-105

Parent Item Name: Crosstube Fwd

85314

D407-667-105

Start Date: 05/06/2012

Required Date: 19/06/2012

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP Rev:F 05.09.01 Add holes for compatibility with Bell SkidtubesKJ/JLM
 IPP Rev:G 08-05-16 chg QC6 to QC15 DD verified by:EC
 IPP Rev:H 08-06-03 update as per DSI9415 (ECN1198) DD verified by:ec
 IPP Rev:I 08-07-14 add (scribe inside of tube) seq.6 DD verified by:EC
 IPP Rev:J 08-07-28 update as per (par 08-013) DD verified by:EC
 IPP Rev K 09.01.06 ECN 08-562 EC verified by:DD IPP REV:L
 11.08.05 PER ECN 11-615 DD VERF:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D407-667-105TRN

Manufactured

No

110

Each

2.0000

1

1

D407-667-105TRN

Crosstube Turning Detail

85320

**

①

MO

12/7/31

Location

Loc Qty

Loc Code

LG

2

83841

1

83842

1

D2873-043

Manufactured

No

230

Each

40.0000

2

2

D2873-043

Nut Plate Assembly

**

AS

12-8-7

Location

Loc Qty

Loc Code

LG052

40

72644

2

82949

38

D2873-045

Manufactured

No

230

Each

33.0000

2

2

D2873-045

Nut Plate Assembly

**

AS

12-8-7

Location

Loc Qty

Loc Code

LG052

33

82947

33

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Offset/Setup											
Other											
Process											
Supplier											
Training											
Unauthorized											

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material	<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Picklist Print

June-05-12 3:36:21 PM

Page 2

Work Order ID: 85314

Parent Item: D407-667-105

Parent Item Name: Crosstube Fwd

85314

D407-667-105

Start Date: 05/06/2012

Required Date: 19/06/2012

Start Qty: 1.00

Required Qty: 1.00

D2891-1 Manufactured No

230

Each

37.0000

2

2

D2891-1

2.25 Support

**

AP 12-8-7

Location

Loc Qty

Loc Code

LG051

20

84164

20

LG052

17

72822

1

75176

1

82277

15

D3595-063-395

Manufactured No

230

Each

46.0000

4

4

D3595-063-395

RUBBER CUSHION

**

AP 12-8-7

Location

Loc Qty

Loc Code

LG051

46

82223

46

MS20601-AD4W10

Purchased No

230

Each

204.0000

14

14

MS20601-AD4W10

RIVET

**

AP 12-8-7

Location

Loc Qty

Loc Code

LG050

203

120676

3

121690

100

125125

100

LG051

1

118675

1

D206-667-017

88731 (x)

①

AP 12-8-7

June-05-12 3:36:21 PM

Shop Packet Print

Page 2

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Offset/Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unauthorized <input type="checkbox"/>											

FAULT CATEGORY									
Landing Gear			Hardware			General			
<input type="checkbox"/> Bending Passes Below Min	<input type="checkbox"/> Breaking	<input type="checkbox"/> Burrs	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Set-up					
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> Missing	<input type="checkbox"/> Contamination	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Supplier					
<input type="checkbox"/> Cracks	<input type="checkbox"/> Size/Length	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Off-Set	<input type="checkbox"/> Temperature/Cure					
<input type="checkbox"/> Crushed/Crimp at Bending	<input type="checkbox"/> Spinning	<input type="checkbox"/> Documentation/Data	<input type="checkbox"/> Orientation Misread	<input type="checkbox"/> Weld					
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Threading	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Calibration	<input type="checkbox"/> Wrong Stock Pulled					
<input type="checkbox"/> Other	<input type="checkbox"/> Wrong	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Other					
<input type="checkbox"/> Positioned Wrong	Drill Holes		<input type="checkbox"/> Outside Dimensions						
<input type="checkbox"/> Ripples on Inner Bend	<input type="checkbox"/> Misaligned	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Over/Under tolerance						
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Ovalized	<input type="checkbox"/> Jigs/Fixtures/Tooling	<input type="checkbox"/> Part Lost						
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Over/Undersized	<input type="checkbox"/> Kit Incorrect	<input type="checkbox"/> Part Moved						
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Too Many	<input type="checkbox"/> Kit Missing	<input type="checkbox"/> Raw Material						

Picklist Print

June-05-12 3:36:21 PM

Page 3

Work Order ID: 85314

Parent Item: D407-667-105

Parent Item Name: Crosstube Fwd

85314

D407-667-105

Start Date: 05/06/2012

Required Date: 19/06/2012

Start Qty: 1.00

Required Qty: 1.00

MS21920-20

Purchased

No

230

Each

86.0000

4

4

MS21920-20

Clamp (per MIL-DTL-8783C)

**

AP 12-8-7

Location

Loc Qty

Loc Code

LG050

86

116799

8

120676

8

121067

20

121274

50

Purchased

No

250

Each

215.0000

10

10

AN5-10A

AN5-10A

Bolt

**

M122151

SP

Location

Loc Qty

Loc Code

ST337

215

118191

80

121181

35

121243

100

Purchased

No

250

Each

65.0000

4

4

AN5-30A

AN5-30A

BOLT

**

12/8/14

SP

Location

Loc Qty

Loc Code

ST339

65

117514

7

120423

3

120910

25

121259

30

June-05-12 3:36:21 PM

Shop Packet Print

Page 3

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td><input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td><input type="checkbox"/></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>	<input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	<input type="checkbox"/>
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>	<input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	<input type="checkbox"/>															

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Offset/Setup									
Other									
Process									
Supplier									
Training									
Unauthorized									

FAULT CATEGORY

Landing Gear	Hardware	General	Maintenance
<input type="checkbox"/> Bending Passes Below Min	<input type="checkbox"/> Breaking	<input type="checkbox"/> Burrs	<input type="checkbox"/> Set-up
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> Missing	<input type="checkbox"/> Contamination	<input type="checkbox"/> Supplier
<input type="checkbox"/> Cracks	<input type="checkbox"/> Size/Length	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Temperature/Cure
<input type="checkbox"/> Crushed/Crimp at Bending	<input type="checkbox"/> Spinning	<input type="checkbox"/> Documentation/Data	<input type="checkbox"/> Weld
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Threading	<input type="checkbox"/> Finish	<input type="checkbox"/> Wrong Stock Pulled
<input type="checkbox"/> Other	<input type="checkbox"/> Wrong	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Positioned Wrong	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Inspection Unqualified	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Ripples on Inner Bend	<input type="checkbox"/> Misaligned	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Outside Dimensions
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Ovalized	<input type="checkbox"/> Jigs/Fixtures/Tooling	<input type="checkbox"/> Over/Under tolerance
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Over/Undersized	<input type="checkbox"/> Kit Incorrect	<input type="checkbox"/> Part Lost
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Too Many	<input type="checkbox"/> Kit Missing	<input type="checkbox"/> Part Moved
			<input type="checkbox"/> Raw Material
			<input type="checkbox"/> Other

Picklist Print

June-05-12 3:36:21 PM

Page 4

Work Order ID: 85314

Parent Item: D407-667-105

Parent Item Name: Crosstube Fwd

85314

D407-667-105

Start Date: 05/06/2012

Required Date: 19/06/2012

Start Qty: 1.00

Required Qty: 1.00

AN5-32A

Purchased

No

250

Each

245.0000

4

AN5-32A

Bolt

**

4

88

Location

Loc Qty

Loc Code

ST339

145

119862

50

120423

75

120910

20

ST340

100

121541

100

AN960JD516

NAS1149D0563J

Purchased

No

250

Each

0.0000

18

AN960JD516

Washer

MS21042L5

Purchased

No

250

Each

1,409.000

4

MS21042L5

Nut

**

4

88

Location

Loc Qty

Loc Code

300

500

121652

500

ST300

909

108827

8

116105

5

116548

43

117611

18

119109

827

17651

8

June-05-12 3:36:21 PM

Shop Packet Print

Page 4

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Offset/Setup											
Other											
Process											
Supplier											
Training											
Unauthorized											

FAULT CATEGORY												
Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many			General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing			<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material		<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____	

DART SERVICE INSTRUCTION

TO AMEND INSTRUCTIONS FOR CONTINUOUS AIRWORTHINESS ICA-D206-667 Rev. 3 OR LATER

REF. CANADIAN STC: SH01-5

REF. FAA STC: SR01304NY

REF. EASA STC: EASA.IM.R.S.01179

PURPOSE:

The supports on the following crosstubes are now installed using Proseal instead of Magnobond:

D206-667-101 @ CHG 004
D206-667-103 @ CHG 005
D206-667-107 @ CHG 002
D206-667-201 @ CHG 004

D206-667-203 @ CHG 004
D206-667-207 @ CHG 002
D407-667-105 @ CHG 004

CHANGE:

For the crosstubes listed above, section 32.4 of ICA-D206-667 is amended as follows. Use Figures 32-4 to 32-8 of ICA-D206-667 for further reference. For crosstubes of an earlier change number, it is recommended that if the supports are removed, the supports should be reinstalled using the procedure listed below.

32.4 SUPPORT INSTALLATION



- 32.4.1 Locate the area on crosstube for installation of support (ref. Figures 32-4 to 32-8 of ICA-D206-667). For D206-667-101/-103/-107/-201 and D407-667-105 crosstubes, the outward face of the support tabs should be 13.08" (332mm) from the crosstube center. For D206-667-203/-207 crosstubes, the outward face of the support tabs should be 10.03" (255mm) from the crosstube center. Ensure paint finish of crosstube is intact; touch up as required per Chapter 5 (5.3.9) of ICA-D206-667.
- 32.4.2 If present, remove any paint/primer on bottom of supports. Abrade mating surfaces of support and crosstube with 400-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.3 Ensure a layer of 3M Scotch-Weld 2216 B/A Epoxy Adhesive is on the bottom of the support. If required, either apply or touch-up support to have a 0.03" to 0.05" thick layer of adhesive over the entire mating surface. Allow supports to cure for 24 hours.
- 32.4.4 Abrade mating surfaces of support (after cure) and crosstube with 180-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.5 Apply a 0.04" to 0.07" thick layer of Proseal 890 Class B or AMS-S-8802 Class B sealant underneath applicable support and install support.
- 32.4.6 Install the clamps opposite to crosstube support as shown in Figures 32-4 to 32-8 of ICA-D206-667. Install rubber cushions underneath each clamp around the bottom circumference of the crosstube up to the crosstube centerline. Torque clamps 80-100 in-lb (9.0-11.3 Nm). It is acceptable to use smaller or larger sized MS21920-XX clamps than those listed in ICA-D206-667, ensure that after torquing the clamps per this instruction, the nuts are in safety but not bottomed out.
- 32.4.7 Prior to installing crosstube on aircraft, allow supports to cure for 72 hours and recheck torque on clamps.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 11.07.20
CERT. NO.: SH01-5
ISSUE NO.: 3

A	NEW ISSUE	CP	11.07.15
REV.	DESCRIPTION	BY	DATE
DESIGN	90	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	90		
CHECKED	ASS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9565	SHEET 1 OF 1
APPROVED		TITLE	SCALE
DE APPR.		SUPPORT INSTALLATION CHANGE	NTS
DATE	11.07.15	COPYRIGHT © 2011 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

SHIP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 85314 MCT
12/06/05

Item	Qty -145	Part Number	Description
1	X	D407-667-145	CROSSTUBE ASSEMBLY (407 HIGH FWD)
2	1	D6010-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6010-115
FINISHED LENGTH = 113.20±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-145" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 17.8 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER
QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE
THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS
ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 85314 HLTJ
12/06/05

DEO ATTACHED

ECW #11-615
11.07.26


UNDER REVIEW

RELEASED
03/11/12


C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-395 WAS D2856-400-694 (ZN D6-2 & A5-2); REMOVED REF. 7 ADD TOLERANCES (ZN C6-3, C4-3, D2-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	02.05.08
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D407-667-145 REV. C SHEET 1 OF 4 TITLE CROSSTUBE ASSY (407 HIGH FWD) SCALE NTS COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DRAWN	RF		
CHECKED	RF		
MFG. APPR.	RF		
APPROVED	RF		
DE APPR.	RF		
DATE	08.11.06		

8 7 6 5 4 3 2 1


8 7 6 5 4 3 2 1

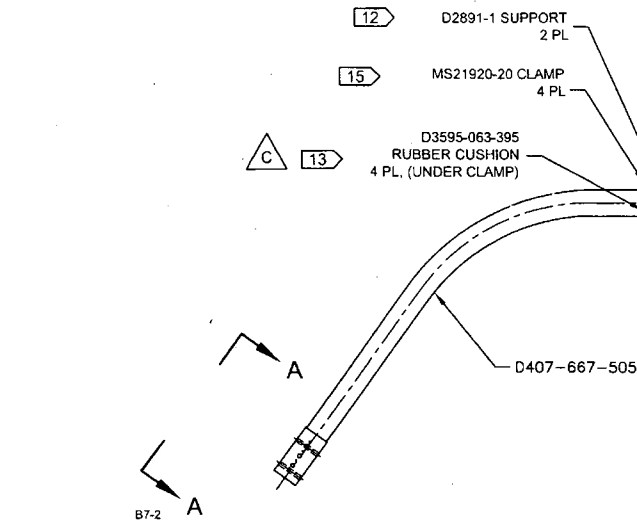


D407-667-145
ASSEMBLY DETAIL
(VIEW LOOKING FWD)

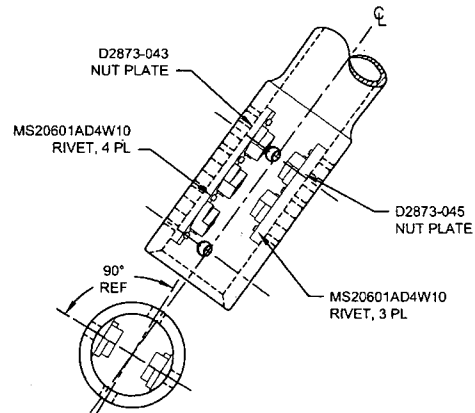

VIEW A-A:
CUFF DETAIL
SCALE 4X

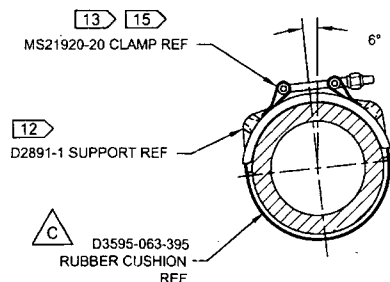

SECTION B-B
SCALE 5X

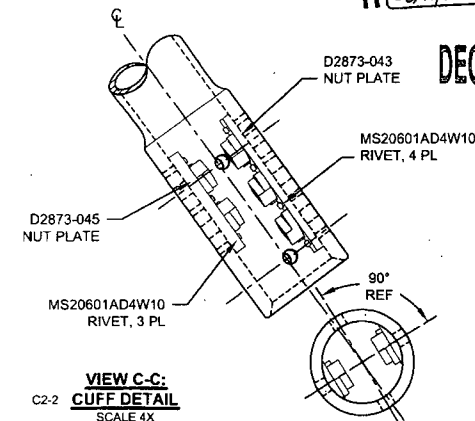

VIEW C-C:
CUFF DETAIL
SCALE 4X

DESIGN	407	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. C
MFG. APPR.	RF	D407-667-145	SHEET 2 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (407 HIGH FWD)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

95314

EC0 #11.615
11.07.28

UNDER REVIEW
9/1/06

RELEASE
08/11/2006

DEO ATTACHED

95314

UNDER REVIEW


07/11/06
ECW #11615
11.07.08

C3-3 **DETAIL H**
SCALE 4X
(VIEW LOOKING FWD)


DEO ATTACHED

RELEASED
08/11/2006


PILOT Ø0.128
C'SINK Ø0.225X100°
3 PL

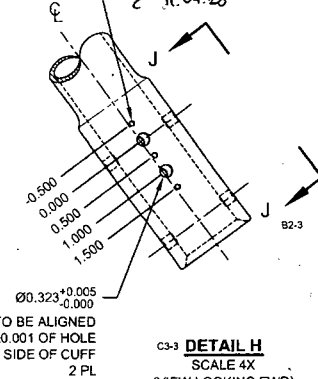

D1-3 **VIEW J-J:**
CUFF DETAIL
SCALE 4X

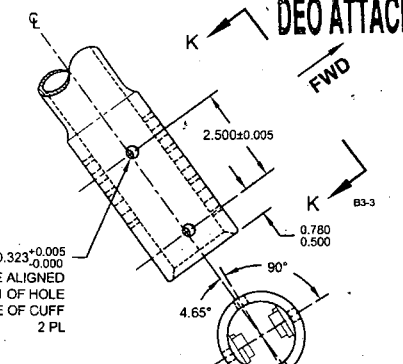


PILOT Ø0.128
C'SINK Ø0.225X100°
4 PL

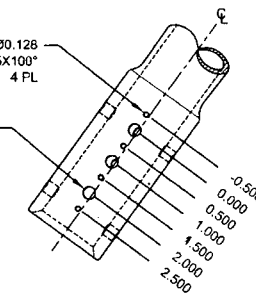


B2-3 **VIEW K-K**
(VIEW LOOKING AFT, ROTATED)


Ø0.323+0.005/-0.000
HOLE TO BE ALIGNED WITHIN ±0.001 OF HOLE ON OTHER SIDE OF CUFF 3 PL

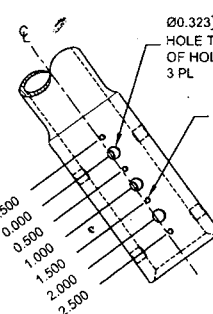

B7-3 **VIEW F-F**
(VIEW LOOKING AFT, ROTATED)


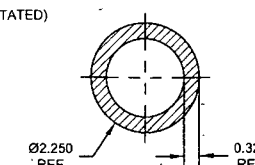


D4-3 **SECTION G-G**
SCALE 5X

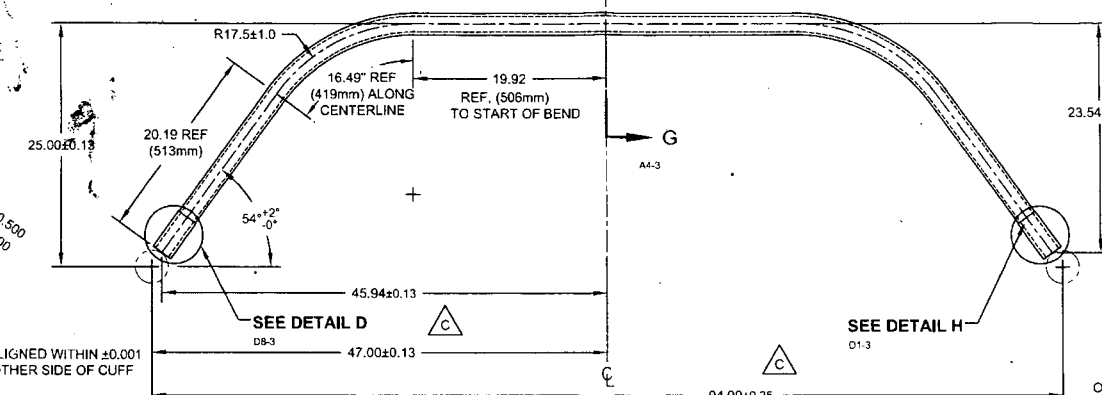

D407-667-505
BENDING AND DRILLING DETAIL
(VIEW LOOKING FWD)

D6-3 **DETAIL D**
SCALE 4X
(VIEW LOOKING FWD)

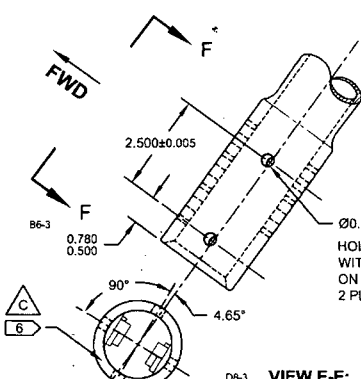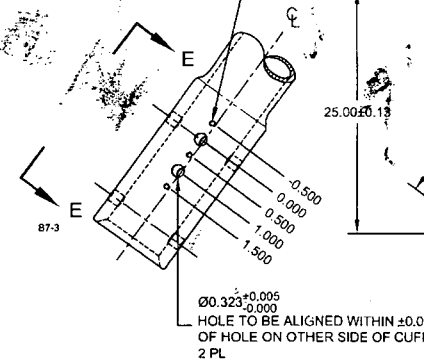


D8-3 **VIEW E-E:**
CUFF DETAIL
SCALE 4X

DESIGN	07	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	07	DRAWING NO.	REV. C
MFG. APPR.	07	D407-667-145	SHEET 3 OF 4
APPROVED	07	TITLE	SCALE
DE APPR.	07	CROSSTUBE ASS'Y (407 HIGH FWD)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	


8 7 6 5 4 3 2 1

85314


UNDER REVIEW
 08/11/08
 11.07.26

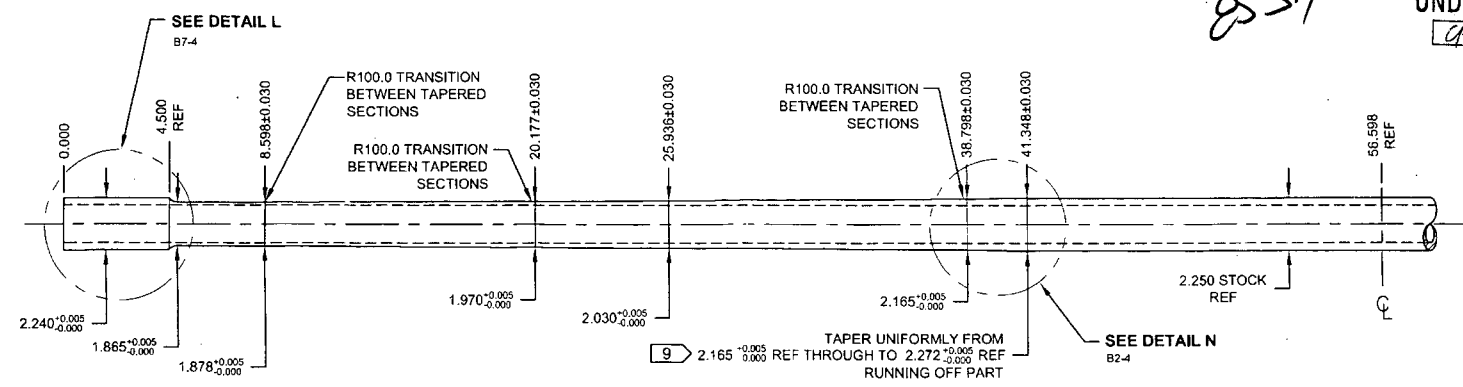


TURNING DETAIL

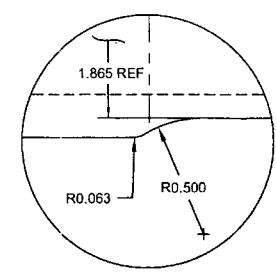

DETAIL M:
 CUFF TRANSITION
 NOT TO SCALE

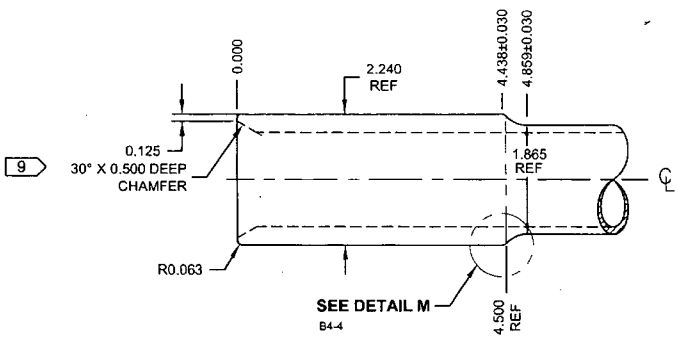

DETAIL L:
 CROSSTUBE CUFF
 NOT TO SCALE

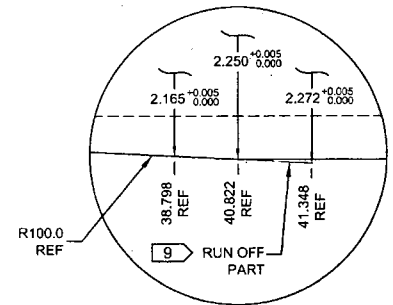

DETAIL N:
 TAPER RUN-OFF
 NOT TO SCALE

DEO ATTACHED
 RELEASED
 08/11/08

DESIGN	90	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	CP	DRAWING NO. D407-667-145	REV. C
MFG. APPR.	GP	SHEET 4 OF 4	
APPROVED	GP	TITLE	SCALE
DE APPR.	GP	CROSSTUBE ASS'Y (407 HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1

DRAWING NO. D407-667-145	TITLE CROSSTUBE ASS'Y (407 HIGH FWD)	REV. C	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-145-C-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>AS</i>	APPROVED <i>WD</i>		DE APPR. <i>HA</i>		
DATE 11.07.15	DATE 11.07.22	DATE 11.07.22	DATE 11/07/22		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -145	Part Number	Description
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2891-1 SUPPORT: ABRAD MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
WD

DART SERVICE INSTRUCTION

TO AMEND INSTALLATION INSTRUCTIONS IIN-D206-667 REV. C AND EARLIER AND
INSTRUCTIONS FOR CONTINUED AIRWORTHINESS ICA-D206-667 REV. 2 AND EARLIER

REF: CANADIAN STC: SH01-5

REF: FAA STC: SR01304NY

REF: EASA STC: EASA.IM.R.S.01179

PURPOSE

The purpose of this service instruction is to add the optional D206-667-017 Kit and provide guidelines to install extra clamps on D206-667-101/-103 or D407-667-105 forward crosstubes to allow fastening of OEM grounding straps.

INSTRUCTIONS:

- 1) If installed, follow Section 32.1 of ICA-D206-667 for removal of the forward crosstube from the helicopter.
- 2) Locate AN742D36 Clamp as shown in Figure 1 of this service instruction and mark location of clamp on the crosstube.
- 3) Remove crosstube finish (paint and primer) in area where AN742D36 Clamp will be installed and touch up affected area with chemical film material (Alodine 1200 or 1201) per MIL-C-5541.
- 4) Install AN742D36 Clamp complete with MS9165-05 per Section A-A of Figure 1 of this service instruction.
- 5) Touch up paint as required per Item 5.3.3 of ICA-D206-667.
- 6) Seal edges where AN742D36 Clamp meets with crosstube using Sikaflex-241/291 or MIL-S-8802 Class B2 or Proseal 890 sealant.
- 7) Install/re-install forward crosstube in accordance with Section 32.2 of ICA-D206-667.
- 8) Fasten OEM grounding strap to MS9165-05 Angle Bracket on forward crosstube per Bell instructions.
- 9) Undertake a resistance check between a ground point on the skidtube and aircraft ground in accordance with Class R-II requirement per BHT-ELEC-SPM. Maximum resistance is 10 milliohms (mΩ).

PARTS LIST:

QTY -017	PART NUMBER	DESCRIPTION
X	D206-667-017	GROUNDING STRAP INSTALLATION
2	AN742D36	CLAMP
2	MS9165-05	ANGLE BRACKET
2	MS21042-3	NUT
2	MS27039-1-08	SCREW
4	NAS1149C0332R	WASHER

WEIGHT AND BALANCE




There is a negligible weight change associated with the installation of this kit.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 11.02.25
CERT. NO.: SH01-5
ISSUE NO.: 3

A	NEW ISSUE	MB	11.02.18
REV.	DESCRIPTION	BY	DATE
DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9544	SHEET 1 OF 2
APPROVED		TITLE	SCALE
DE APPR.		GROUNDING STRAP INSTALLATION	NTS
DATE	11.02.18	COPYRIGHT © 2011 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other


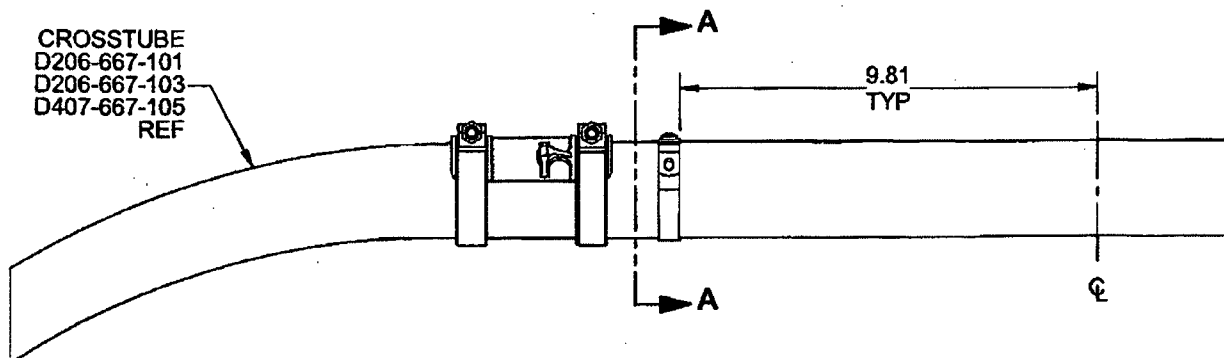


FIGURE 1 - GROUNDING STRAP INSTALLATION
(VIEW LOOKING FWD)

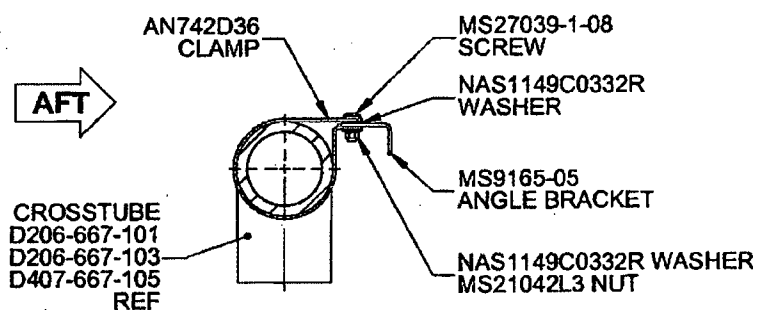

SECTION A-A
(SUPPORT, CLAMP, CUSHION NOT SHOWN FOR CLARITY)
TYP, 2 PL PER CROSSTUBE

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED
BY: *[Signature]*
D. SHEPHERD (DE # 02)

DATE: 11.02.25
CERT. NO.: SH01-5
ISSUE NO.: 3

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9544	SHEET 2 OF 2
APPROVED		TITLE	SCALE
DE APPR.		GROUNDING STRAP INSTALLATION	NTS
DATE	11.02.18	COPYRIGHT © 2011 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Setup											
Other											
Process											
Supplier											
Training											
Unapproved											

FAULT CATEGORY			
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

REFERENCE ONLY**5.0 PARTS LIST****5.1 HIGH GEAR CROSSTUBES**

Item	Qty -101	Qty -201	Qty -103	Qty -203	Qty -105	Qty -205	Part Number	Description
	X						D206-667-101	CROSSTUBE INSTALLATION, 206A/B HIGH FWD
		X					D206-667-201	CROSSTUBE INSTALLATION, 206A/B HIGH AFT
			X				D206-667-103	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH FWD
				X			D206-667-203	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH AFT
					X		D407-667-105	CROSSTUBE INSTALLATION, 407 HIGH FWD
						X	D407-667-205	CROSSTUBE INSTALLATION, 407 HIGH AFT
1	1						D206-667-141	CROSSTUBE ASSEMBLY, 206A/B HIGH FWD
2		1					D206-667-241	CROSSTUBE ASSEMBLY, 206A/B HIGH AFT
3			1				D206-667-143	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH FWD
4				1			D206-667-243	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH AFT
5					1		D407-667-145	CROSSTUBE ASSEMBLY, 407 HIGH FWD
6						1	D407-667-245	CROSSTUBE ASSEMBLY, 407 HIGH AFT
10	*2	*2	*2		*2		D2891-1	SUPPORT
11				*2			D2892-1	SUPPORT
12						*1	D2894-1	SUPPORT
13	*4	*4	*4		*4		D3595-063-395	RUBBER CUSHION
14				*4			D3595-063-450	RUBBER CUSHION
15						*2	D3595-075-430	RUBBER CUSHION
16	*4	*4	*4		*4		MS21920-20	CLAMP
17				*4		*4	MS21920-22	CLAMP
18						*2	MS21920-25	CLAMP (OR MS21920-24)
19	4	4	4		4		AN5-32A	BOLT
20				4		4	AN5-34A	BOLT
21	4	4	4	4	4	4	MS21042L5	NUT (OR MS21042-5)
22	8	8	8	8	8	8	NAS1149C0563J	WASHER (OR AN960JD516)
23						*2	D3190-1	CHAFING SHIELD
40	*2		*2	*2	*2	*2	D2873-043	NUT PLATE
41	*2		*2	*2	*2	*2	D2873-045	NUT PLATE
42		2					D2872-043	NUT PLATE
43		2					D2872-045	NUT PLATE
44	10		10				AN5-7A	BOLT
45		10		10	10	10	AN5-10A	BOLT
46	4	10	4		4		AN5-30A	BOLT
47				4		4	AN5-32A	BOLT
48			12				AN970-4	WASHER (OPTIONAL)
49		6					MS21042L5	NUT (OR MS21042-5)
50	10	12	10	10	10	10	NAS1149C0563J	WASHER (OR AN960JD516)
60		1					D3039-3	CENTER DRILL (TOOLING, NOT INSTALLED)

*REFERENCE ONLY. PARTS ARE INCLUDED IN D206-667-141/-143/-241/-243 & D407-667-145/-245
ASSEMBLIES ABOVE

• COPYRIGHT © 2001 BY DART AEROSPACE LTD •
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED
OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Revision: **D**

Date: 11.05.01



RAPPORT D'INSPECTION NON DESTRUCTIVE (SUITE)

RAPPORT# P-12305

PAGE 2 DE 2

CLIENT Dart Aerospace DATE August 3, 2012 HEURE ☒ AM ☐ PM
ATTENTION Linda ACUREN W/O: 188-12-C0305 7:30

RÉSULTATS (☐ MÉTRIQUE ☐ IMPÉRIALE)

- 1) 3X D412-664-203 Crosstube AFT WO ID: B87295-B86985-B86986
PT Done IAW ASTM E1417-05 Found accepted
- 2) 1X D212-664-201 Crosstube AFT WO ID: B85563
PT Done IAW ASTM E1417-05 Found accepted
- 3) 2X D206-667-103 Crosstube FWD WO ID: B88697-B88696
PT Done IAW ASTM E1417-05 and Found accepted
- 4) 2X D407-667-105 Crosstube FWD WO ID: B85313-B85314
PT Done IAW ASTM E1417-05 and Found accepted
- 5) 5X D3011-1 Rappel WO ID: 86212
PT Done IAW ASTM E1417-05 and Found accepted

P/O 17609

12 08 04

Étendue des services

L'entente selon laquelle le Groupe Acuren Inc. Exécute les services ne concerne que les énoncés par écrit. En aucune circonstance ces services ne s'étendent au-delà de l'exécution des services demandés. Il est entendu que toutes les descriptions, les observations et les expressions d'opinions faites par Acuren reflètent les opinions ou les observations de l'entreprise fondées sur l'information et les hypothèses fournies par le propriétaire/opérateur, et elles ne constituent pas des déclarations ou des garanties ou ne peuvent être interprétées comme constituant. Le groupe Acuren Inc. N'assume aucune des responsabilités du propriétaire/opérateur, et le propriétaire/opérateur conserve la responsabilité entière des décisions prises en matière d'ingénierie, de fabrication, de réparation et d'usage à partir de l'information ou des données fournies par Acuren en rapport avec les services décrits dans les présentes ne peuvent excéder le coût des services rendus.

Norme de Diligence

Dans l'exécution des services, le Groupe Acuren inc. Applique le degré de diligence, le soin et la compétence normalement exercés dans des circonstances semblables par d'autres fournisseurs de ce type de services opérant dans la même localité ou dans une localité similaire. Aucune autre garantie, implicite ou explicite, n'est faite ou voulue par le Groupe Acuren Inc.

SIGNATURES

REPRÉSENTANT CLIENT	<u>Andy Sheldon</u>	FTJ#:
TECHNICIEN (SIGNATURE):	<u>Philippe Barre</u>	RAPPORT
NOM (MOULIÉ):	<u>Philippe Barre</u>	RÉVISÉ PAR:
		NOM INITIALES
ONGC NIVEAU <u>2</u> SNT NIVEAU <u>2</u>	ONGC NIVEAU _____ SNT NIVEAU _____	
ONGC N° REGISTRATION <u>12027</u>	ONGC N° REGISTRATION _____	